

Manhole Inspection Summary

Manhole # S19CC1016MH

Printed On: 12/17/2008

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **19CC1** Node: **016** Status: **Found**

Insp Date: **3/12/07 1:18 PM**

Incomplete Comments

Crew: **CH, JJ**
Inspector: **Hale, C**
Firm: **RKK**

Location Address: **3665 KEYSTONE AVE**

Cross Street: **ROCKROSE AVE**

Manhole Type: **Terminal**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **Sheeting**

Comments

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **19** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **42** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench

☒ Exists Material: **Brick**

☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **1.5** nearest .5 ft. Azimuth: **120**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

Steps

Count: **6** Missing: **1** ☒ **Corroded**

Surcharge

☒ **Evidence Of Surcharge**

Depth: **2** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S19CC1016MH

Printed On: 12/17/2008

Page 2 of 3

Location View



Top View




Corroded steps. Evidence of surcharge - Bench debris. Channel debris.

Inside of the I9



Abandoned.

Defect

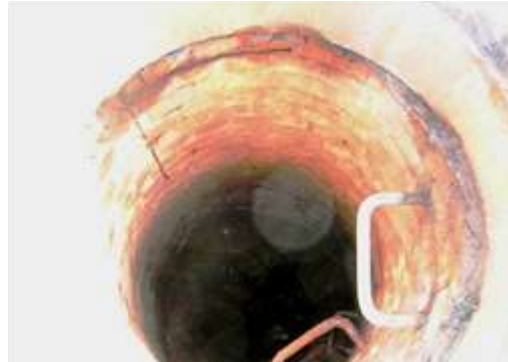

Adjustment and Corbel deterioration and infiltration. Barrel infiltration - other side.

Defect



Barrel infiltration.

Defect



Adjustment and Corbel deterioration and infiltration. Barrel infiltration.

Manhole Inspection Summary

Manhole # S19CC1016MH

Printed On: 12/17/2008

Page 3 of 3

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Barrel deterioration and infiltration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.33** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.09** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection